

WIRING INSTRUCTIONS

TITLE

2-SPEED HOLE HAWG



MILWAUKEE ELECTRIC TOOL CORP.

13135 WEST LISBON RD. BROOKFIELD, WIS

DATE
April '76

BULLETIN

58-01-0624

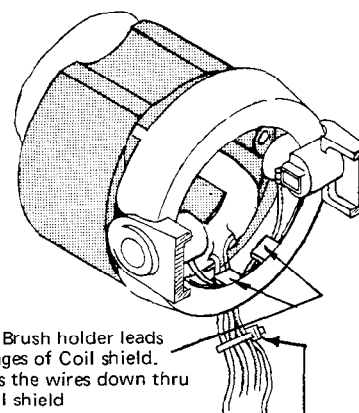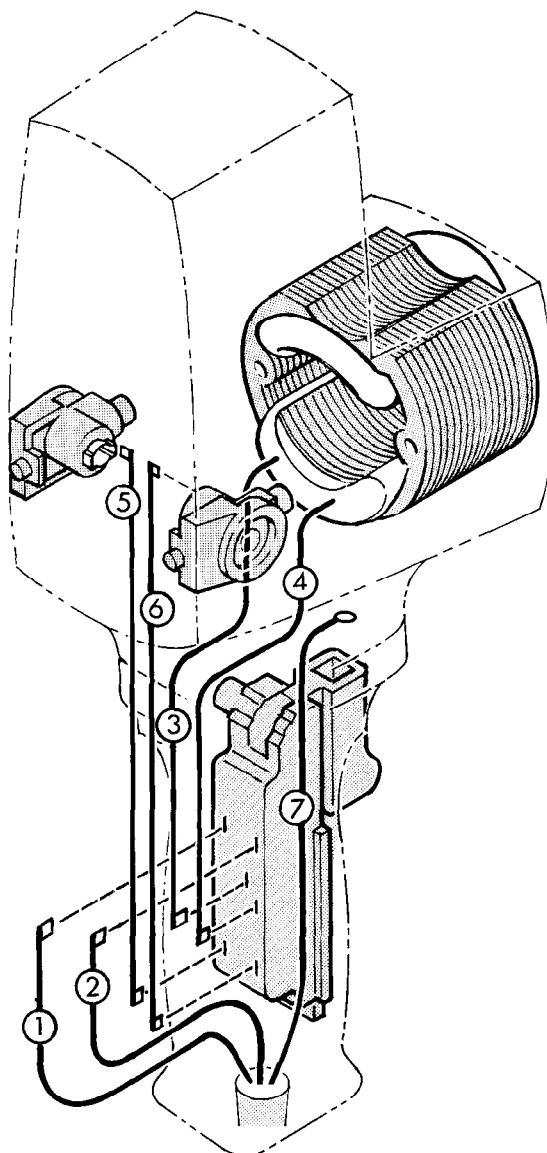

Run both Brush holder leads
under flanges of Coil shield.
Then dress the wires down thru
slot in Coil shield

Field and Brush Holder Wires
Should be tied Together with
Wire Tie 23-78-0100

WIRING SPECIFICATIONS

Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation.
1	Black	Cord	3-3/4"	Strip 3/8" for T1
2	White	Cord	3-3/4"	Strip 3/8" for T1
3	Yellow	Field	5-1/4"	Strip 3/8" for T1
4	Black	Field	5-3/8"	Strip 3/8" for T1
5	White	16	7-1/8"	Strip 3/8" for T1 / Strip 3/8" for T1
6	Red	16	7-1/8"	Strip 3/8" for T1 / Strip 3/8" for T1
7	Green	Cord	7-1/4"	Strip 3/16" for T2

NOTE:

All leads must be held to $\pm 1/8"$.
All field leads to be measured from
and perpendicular to laminations.
All lead lengths are before stripping.

TERMINAL DESCRIPTION

Code	Part No.	Qty.
T1	22-44-0090	8
T2	23-74-0390	1

CONNECTOR DESCRIPTION

Code	Part No.	Qty.